

**Customer Advice Note  
CAN #142**

**Galaxy RIO C072  
Jumpers**

**Date: August/2021**

## Introduction

This Customer Advice Note details a problem with the Galaxy RIO (**C072**) Jumpers  
A number of the Galaxy RIO have shipped with the jumpers **LK2** and **LK4** open on the PCB.

## Products Affected


C072

## Identification

Only product manufactured during 2021 is affected.

## Attention: Resolution

Remove the Galaxy RIO (**C072**) unit from the cardboard giftbox. (Retain any fixings and packaging)  
Locate the **LK2** and **LK4** Jumper terminals on the PCB. These Jumpers should be in a closed position.

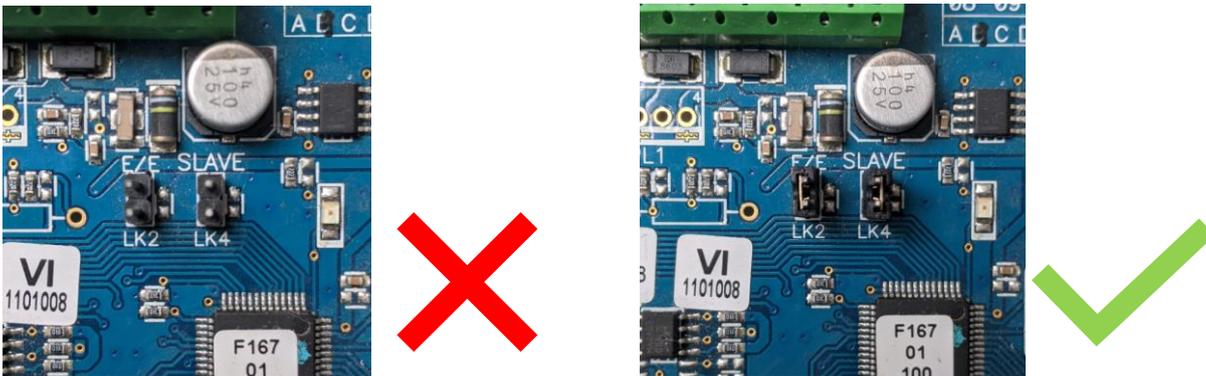

Please fit 2 Jumper links to close **LK2** and **LK4** as per picture above.

When LK2 and LK4 are removed the RIO is configured for a standalone feature which is not compatible with connection to a Galaxy control unit. Enrolment of RIO in this configuration results in the zones being unresponsive.

**NOTE: If RIO is added to the system please remove from the RS485 and re-add with Jumpers pre-fitted.**

For further enquires contact Technical support or your local sales representative

**E-mail:** [hsguktechsupport@honeywell.com](mailto:hsguktechsupport@honeywell.com)

**Tel:** +44 1 344 238 266

Impact

Hardware	y
Reporting	n
Standards and Legislation	n
Part Numbers Affected	y

Miscellaneous Changes	n
Signaling Changes	n
Technical Changes	n
Programming	n